Navajo Abandoned Uranium Mine

Site Screen Report

This form is for use at the site of abandoned uranium mines (AUM) located on Navajo Nation lands. Applicable sites include all mine and mine features that have or have not undergone reclamation by the Navajo Abandoned Mine Lands Reclamation Program, including features, adits, pits and waste piles. Applicable sites also include all AUM sites listed in the USEPA CERCLIS database, all sites listed in the 2008 AUM GIS Report issued by USACOE and USEPA, all AUM sites on allotment lands associated with the Navajo Nation, and any and all AUM sites not listed in any database located on Navajo lands. Reconnaissance of any sites located on lands adjacent to Navajo lands that may be impacting Navajo lands will need to be coordinated with the authorities appropriate to those lands.

The purpose of the form is to ascertain the status and location of the identified AUM site, and record all immediate site information associated with the mine site. Decisions and recommendations on what additional steps are needed will be provided on a separate document.

Bec068 AUM Site

Navajo AUM Northern Region

Prepared by:

Weston Solutions, Inc.

Contract: W91238-06-F-0083

12767.063.496.1111

March 2010

Part I Site Identification, Location and Status Site Names and ID numbers as applicable **Mine ID:** 445 Map ID: N76 **CERCLIS:** NNN000908898 Navajo Abandoned Mine Land Reclamation Program: None Local name / Aliases: None Chapter and local area: Beclabito Chapter **County:** San Juan **State:** New Mexico **Lat/Long:** 36.7991087054 N / -109.00756523 W **Nearby road and highway:** Indian Route 63 Local Post Office: Beclabito, NM Surface Land Status: check one or more and provide ownership and contact information below **Tribal Trust Land Public lands Private Tribal Fee Land Bureau of Land Mgmt Allotment** Fee land State **Subsurface Mineral Rights:** No information on subsurface mineral rights ownership was found in the EPA/AUM Database. Claim and operator information: The mine site surface land status is classified as Tribal Trust Land. No other historical ownership / lease information was identified in the EPA/AUM database. Number of residential structures within 200 feet of mine: None **Estimated volume of mine waste onsite:** $1,042 \text{ yd}^3$

Part II Summary of radiological readings

Highest gamma radiation measurement:

56,965 counts per minute (cpm)

Describe any other radiological measurements:

A total of 2,559 gamma radiation measurements were collected from the mine site, ranging from 6,297 cpm to 56,965 cpm. Measurements in the vicinity of the waste debris were found at levels in up to 30,000 cpm. The measurements are represented in Figures 1 and 2.


Background Locations

Average background = 9,975 cpm

#1 10,719 cpm #2 9,231 cpm

Distribution Chart and Statistics:

The following chart and statistics were generated by ESRI ArcGIS 9.3.1, and show the general distribution of the site gamma radiation measurements. The horizontal X axis represents the gamma radiation reading levels in cpm (lowest levels to the left). The vertical Y axis represents the frequency of each gamma radiation level.

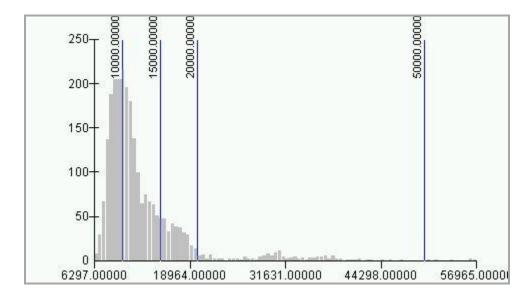

 Count:
 2559

 Minimum:
 6297,00000

 Maximum:
 56965,00000

 Sum:
 31994741,00000

 Mean:
 12502,82962

 Median:
 10725,00000

 Standard Deviation:
 5844,76026

Part III Status of Reclamation and Mine Waste

The following information was obtained from the Navajo Abandoned Mine Land Reclamation Program (NAMLRP) Point Features Database:

NAMLRP Status of the mine site: Reclaimed: No Waste Pile onsite: No

NAMLRP Project Number: None

NAMLRP Mine features: 1 Rim Strip / Pit

The following information was obtained from field observations collected during the 2009 site screening:

Provide description and status of all mine sites and features at site. Include all waste piles, adits, pits and other features, and indicate whether they are open, closed, covered, capped, buried or unreclaimed. Indicate approximate size, shape and extent, including description of any reclamation caps. Note condition of all caps.

Observed	reclamati	ion work	and s	tatuc
AMSCI VCU	Itualial	IUII WUIK	anus	MALUS.

Adits

None

Waste Piles

Medium waste pile on northern face, 75' x 75', with a total estimated volume of 1,042 yd³

Pits

None

Shafts

None

Other Debris and Mine Features

None

Part IV

Site observations and Environs

Observed Structures: list number of and describe human habitation status of structures at the following distances from mine:

0 to 200 feet: None

200 feet to 0.25 mile: None

Observed Public or commercial structure: list and describe all schools, clinics, Chapter Houses, places of business and any other structure used by members of the community at the following distances:

0 to 200 feet: None

200 feet to 0.25 mile: None

Levels measured around the perimeter(s) of the identified structure(s):

None

Observed water sources: list the number and type of wells and surface water sources that are potentially used for human consumption at the following distances from the mine:

0 to 0.25 miles: None

0.25 miles to 4 miles: None

Sensitive environments: note and describe all sensitive environments located within visible range of the mine site, including: wetlands, endangered species, habitats and approximate locations of sites that may be under protection of the government of the Navajo Nation.

None observed

Known Site History: include information from interviews with Chapter officials and residents. Note information on mine ownership, type of mining operation, period of operation, known amount of production, and any other information as provided.

Bec068 mine consists of an area of 17,666.51 m². The mine was not identified as ever being operational. No other historical information or any additional ownership / lease information was identified in the EPA/AUM database.

Part V Response Action Summary

Site Name(s): Bec068 **Chapter:** Beclabito

Decision Criteria

Is there an unreclaimed waste pile at the site? Yes

At what distance from the waste pile is the nearest residential structure located? None

At what distances from the waste pile are there potential drinking water sources? None

Is there a reclamation cap or sealed adit in place at the site? None

Is the cap/seal functionally intact? None

Is the cap/seal sufficiently degraded to create a concern about releases? No

At what distance from the cap/seal is the nearest domestic structure located? None

At what distance from the cap/seal is the nearest domestic drinking water source? None

Summary of emergency response factors

None

Summary hazard ranking system factors

None

Summary of reclamation factors

Unreclaimed waste pile

Part VI **Photos**



Photo 1. Mine site




Part VII Contacts Reports and Information

Name:	<u>Stanley Edison (928) 871-6861</u>			
	Eugene Esplain (928) 871-7331			
Title or of	fficial role (if any) Navajo EPA Superfund Program			
Address_	PO Box 2946, Window Rock, AZ 86515			
Information	on provided Lead Regulatory Agency			
Name				
Title or official role (if any)				
Address				
Telephone number				
Information provided				
Name				
Title or of	_			
Telephone number				
Information provided				
Name				
	fficial role (if any)	_		
	e number			
	on provided			

Figure 1 - Gamma Radiation Measurements, Above Two Times Background
Bec068 (445)
Beclabito Chapter, Navajo Nation, Arizona





Gamma survey conducted 10/2009 Measured as counts per minute (cpm)

Average background = 9,975 cpm




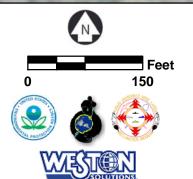


Figure 2 - Gamma Radiation Measurements Bec068 (445) Beclabito Chapter, Navajo Nation, Arizona

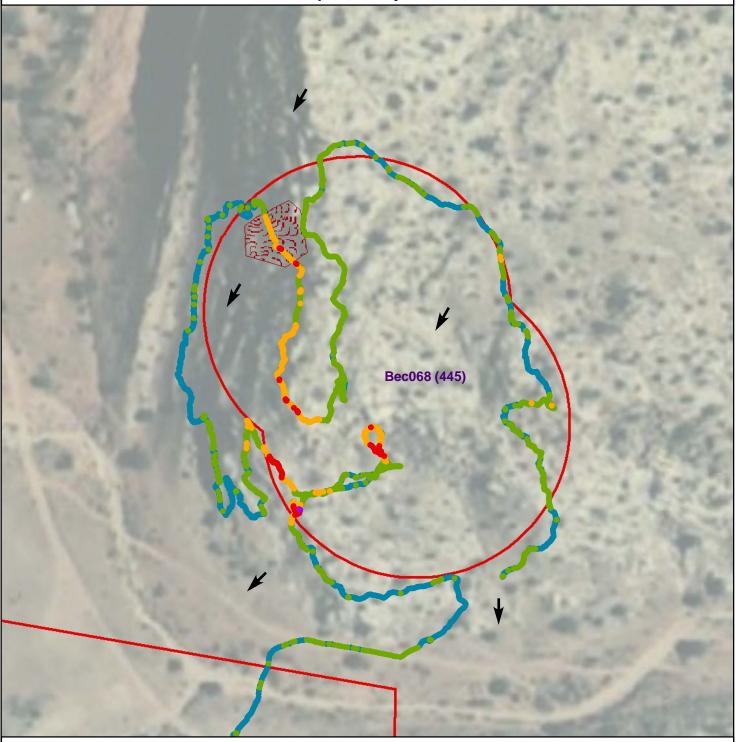

Legend

Gamma Radiation Measurements

- 0 10,000
- 10,000 15,000
- **15,000 20,000**
- 20,000 50,000
- 50,000 100,000
- > 100,000



Gamma survey conducted 10/2009 Measured as counts per minute (cpm)

Average background 9,975 cpm

