

# Navajo Abandoned Uranium Mine

## Site Screen Report

*This form is for use at the site of abandoned uranium mines (AUM) located on Navajo Nation lands. Applicable sites include all mine and mine features that have or have not undergone reclamation by the Navajo Abandoned Mine Lands Reclamation Program, including features, adits, pits and waste piles. Applicable sites also include all AUM sites listed in the USEPA CERCLIS database, all sites listed in the 2008 AUM GIS Report issued by USACOE and USEPA, all AUM sites on allotment lands associated with the Navajo Nation, and any and all AUM sites not listed in any database located on Navajo lands. Reconnaissance of any sites located on lands adjacent to Navajo lands that may be impacting Navajo lands will need to be coordinated with the authorities appropriate to those lands.*

*The purpose of the form is to ascertain the status and location of the identified AUM site, and record all immediate site information associated with the mine site. Decisions and recommendations on what additional steps are needed will be provided on a separate document.*

### **Ramco No. 20 AUM Site**

**Navajo AUM Western Region**

**Prepared by:**

**Weston Solutions, Inc.**

**Contract: W91238-06-F-0083**

**12767.063.599.1111**

**January 2011**

**Part I Site Identification, Location and Status**

**Site Names and ID numbers as applicable**

**Mine ID:** 153

**Map ID:** W94

**CERCLIS:** NNN000909080

**Navajo Abandoned Mine Land Reclamation Program:** NA-0173; NA-0174; NA-0175

**Local name / Aliases:** RAMCO No. 20; RAMCO #20

**Chapter and local area:** Coalmine Mesa Chapter

**County:** Coconino **State:** Arizona

**Lat/Long:** 35.7355447295 N / -111.298784747 W

**Nearby road and highway:** Indian Route 6730 **Local Post Office:** Cameron, AZ

**Surface Land Status: check one or more and provide ownership and contact information below**

<b>Tribal Trust Land</b>	<input checked="" type="checkbox"/>	<b>Public lands</b>	<input type="checkbox"/>
<b>Private</b>	<input type="checkbox"/>	<b>Tribal Fee Land</b>	<input type="checkbox"/>
<b>Bureau of Land Mgmt</b>	<input type="checkbox"/>	<b>Allotment</b>	<input type="checkbox"/>
<b>State</b>	<input type="checkbox"/>	<b>Fee land</b>	<input type="checkbox"/>

**Subsurface Mineral Rights:**

No information on subsurface mineral rights ownership was found in the EPA/AUM Database.

**Claim and operator information:**

The mine site surface land status is classified as Tribal Trust Land. Historical documents showed the operator of the mine as the Rare Metals Corporation from 1956 to 1960. No additional ownership / lease information was identified in the EPA/AUM database.

**Number of residential structures within 200 feet of mine:** None

**Estimated volume of mine waste onsite:** None

**Part II Summary of radiological readings**

**Highest gamma radiation measurement:**

83,416 counts per minute (cpm)

**Describe any other radiological measurements:**


A total of 5,293 gamma radiation measurements were collected from the mine site, ranging from 9,631 cpm to 83,416 cpm. The measurements collected in the pond area were found mostly at background levels, with a few isolated hot spots with maximum levels of 85,000 cpm. The measurements are represented in Figures 1 and 2.

**Background Readings:** 10,524 cpm; 13,246 cpm; 13,166 cpm

**Background Average:** 12,312 cpm

**Distribution Chart and Statistics:**

The following chart and statistics were generated by ESRI ArcGIS 9.3.1, and show the general distribution of the site gamma radiation measurements. The horizontal X axis represents the gamma radiation reading levels in cpm (lowest levels to the left). The vertical Y axis represents the frequency of each gamma radiation level.

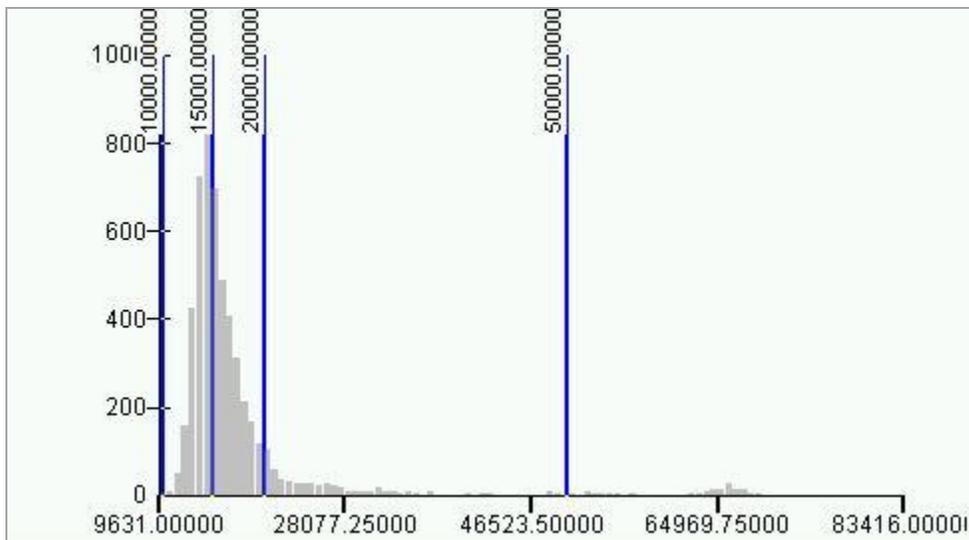

Count:	5293
Minimum:	9631.00000
Maximum:	83416.00000
Sum:	93641289.00000
Mean:	17691.53391
Median:	15242.00000
Standard Deviation:	9102.70465

### **Part III      Status of Reclamation and Mine Waste**

**The following information was obtained from the Navajo Abandoned Mine Land Reclamation Program (NAMLRP) Point Features Database:**

**NAMLRP Status of the mine site: Reclaimed: Yes      Waste Pile onsite: No**

**NAMLRP Project Number: NA-0173; NA-0174; NA-0175**

**NAMLRP Mine features: 1 Rim Strip / Pit**

---

**The following information was obtained from field observations collected during the 2010 site screening:**

**Provide description and status of all mine sites and features at site. Include all waste piles, adits, pits and other features, and indicate whether they are open, closed, covered, capped, buried or unreclaimed. Indicate approximate size, shape and extent, including description of any reclamation caps. Note condition of all caps.**

#### **Observed reclamation work and status:**

##### **Adits**

None

##### **Waste Piles**

None

##### **Pits**

None

##### **Shafts**

None

#### **Other Debris and Mine Features**

Former pond (from topo) and surrounding berm, breaced in the SW, some standing water in effluent area; erosion control berm area, shared with site 151

## Part IV

### Site observations and Environs

**Observed Structures: list number of and describe human habitation status of structures at the following distances from mine:**

**0 to 200 feet:** None

**200 feet to 0.25 mile:** None

**Observed Public or commercial structure: list and describe all schools, clinics, Chapter Houses, places of business and any other structure used by members of the community at the following distances:**

**0 to 200 feet:** None

**200 feet to 0.25 mile:** None

**Levels measured around the perimeter(s) of the identified structure(s):**

None

**Observed water sources: list the number and type of wells and surface water sources that are potentially used for human consumption at the following distances from the mine:**

**0 to 0.25 miles:** Apparent pond area with drainage conduits, mostly dry, some standing water in breached/effluent area in the SW section.

**0.25 miles to 4 miles:** Little Colorado River Basin approximately 1 mi W of the site.

**Sensitive environments: note and describe all sensitive environments located within visible range of the mine site, including: wetlands, endangered species, habitats and approximate locations of sites that may be under protection of the government of the Navajo Nation.**

None observed

**Known Site History: include information from interviews with Chapter officials and residents. Note information on mine ownership, type of mining operation, period of operation, known amount of production, and any other information as provided.**

Ramco No. 20 mine consists of an area of 229,206.3 m<sup>2</sup>. The mine was identified as being operational from 1956 to 1960. Historical documents showed the operator of the mine as the Rare Metals Corporation from 1956 to 1960. While operational, the mine had a total reported production volume of 22,642 tons. The Ramco No. 20, Ramco No. 22 (151), and Ryan No. 2 (152) sites reportedly mined from a single common pit. No other historical information or any additional ownership / lease information was identified in the EPA/AUM database.

**Part V            Response Action Summary**

**Summary of Evaluation Factors:**

***Accessibility:***

**Was the mine easily accessible to potential human activity?**

Yes

***Radiological Measurements:***

**Were any gamma radiation measurements collected at the mine greater than two times the site-specific background levels?**

Yes

***Waste Piles:***

**Were any unreclaimed waste piles observed at the mine with gamma radiation measurements greater than two times the site-specific background levels?**

No

***Structures:***

**Were any structures observed within 200 feet of the mine?**

No

***Potential Drinking Water Sources:***

**Were any potential drinking water sources observed within 4 miles of the mine?**

Yes

***Reclamation:***

**Was the mine reported to be previously reclaimed, or did the mine appear to be reclaimed?**

Yes (erosion control berm)

**Part VI      Photos**



Photo 1. Ramco No. 20 mine site



Photo 2. Ramco No. 20 mine site, pond area



Photo 3. Ramco No. 20 mine site, pond area



Photo 4. Ramco No. 20 mine site, pond area, standing water in effluent channel



Photo 5. Ramco No. 20 mine site, pond area cement barrier/rip rap



Photo 6. Ramco No. 20 mine site, gamma reading collection



Photo 7. Ramco No. 20 mine site



Photo 8. Ramco No. 20 mine site, berm shared with site #151

**Part VII      Contacts Reports and Information**

Name:      Stanley Edison (928) 871-6861

Eugene Esplain (928) 871-7331

Title or official role (if any): Navajo EPA Superfund Program

Address:   PO Box 2946, Window Rock, AZ 86515

Information provided: Lead Regulatory Agency

---

Name: \_\_\_\_\_

Title or official role (if any): \_\_\_\_\_

Address: \_\_\_\_\_

Telephone number: \_\_\_\_\_

Information provided: \_\_\_\_\_

---

Name: \_\_\_\_\_

Title or official role (if any): \_\_\_\_\_

Telephone number: \_\_\_\_\_

Information provided: \_\_\_\_\_

---

Name: \_\_\_\_\_


Title or official role (if any): \_\_\_\_\_

Telephone number: \_\_\_\_\_

Information provided: \_\_\_\_\_

---

**Figure 1 - Gamma Radiation Measurements, Above Two Times Background  
 Ramco No. 20 (153)  
 Coalmine Mesa Chapter, Navajo Nation**

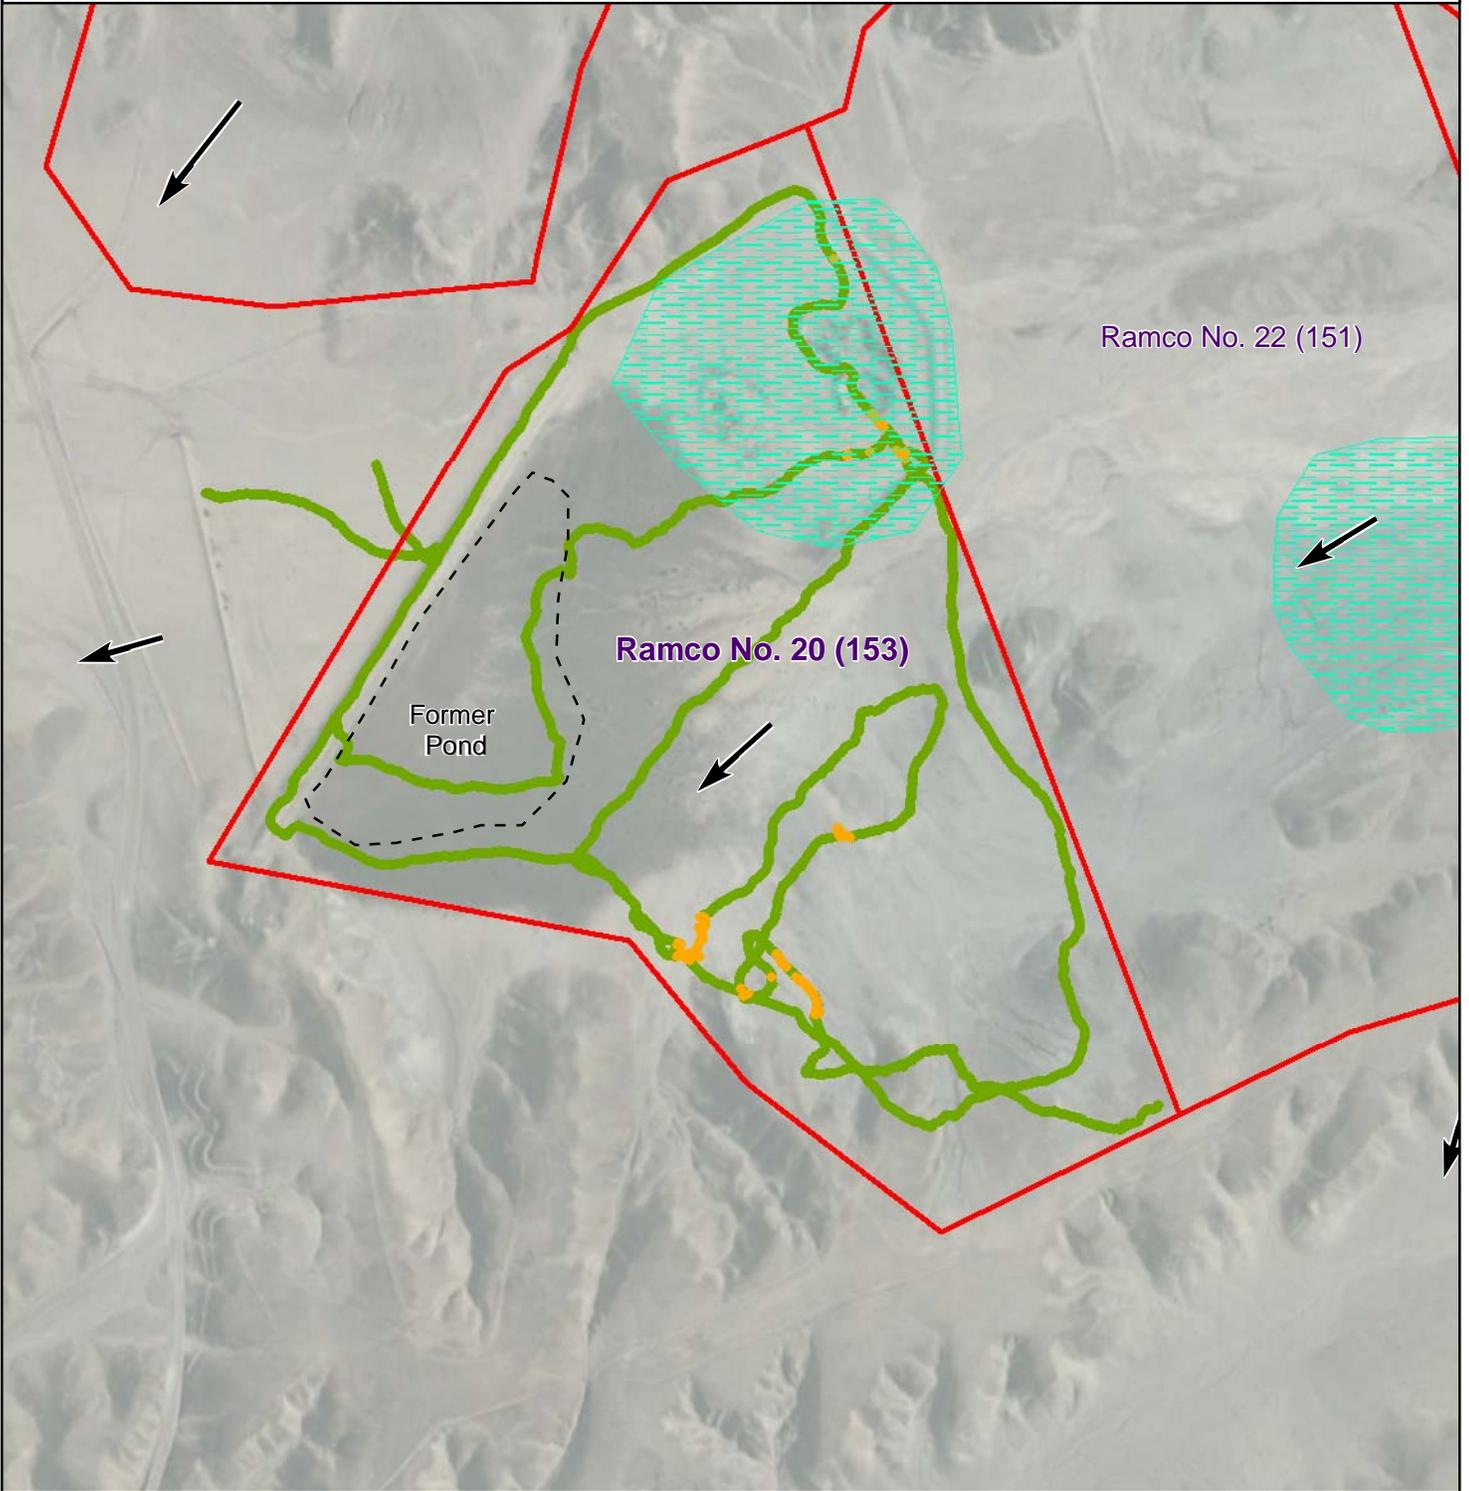

**Legend**

**Gamma Radiation Measurements**

- < 2X Background
- > 2X Background

- General Slope Direction
- Observed Reclamation Area
- Mine Site Boundary




Gamma survey conducted 11/2010  
 Measured as counts per minute (cpm)

Average background 12,312 cpm



**Figure 2 - Gamma Radiation Measurements  
 Ramco No. 20 (153)  
 Coalmine Mesa Chapter, Navajo Nation**

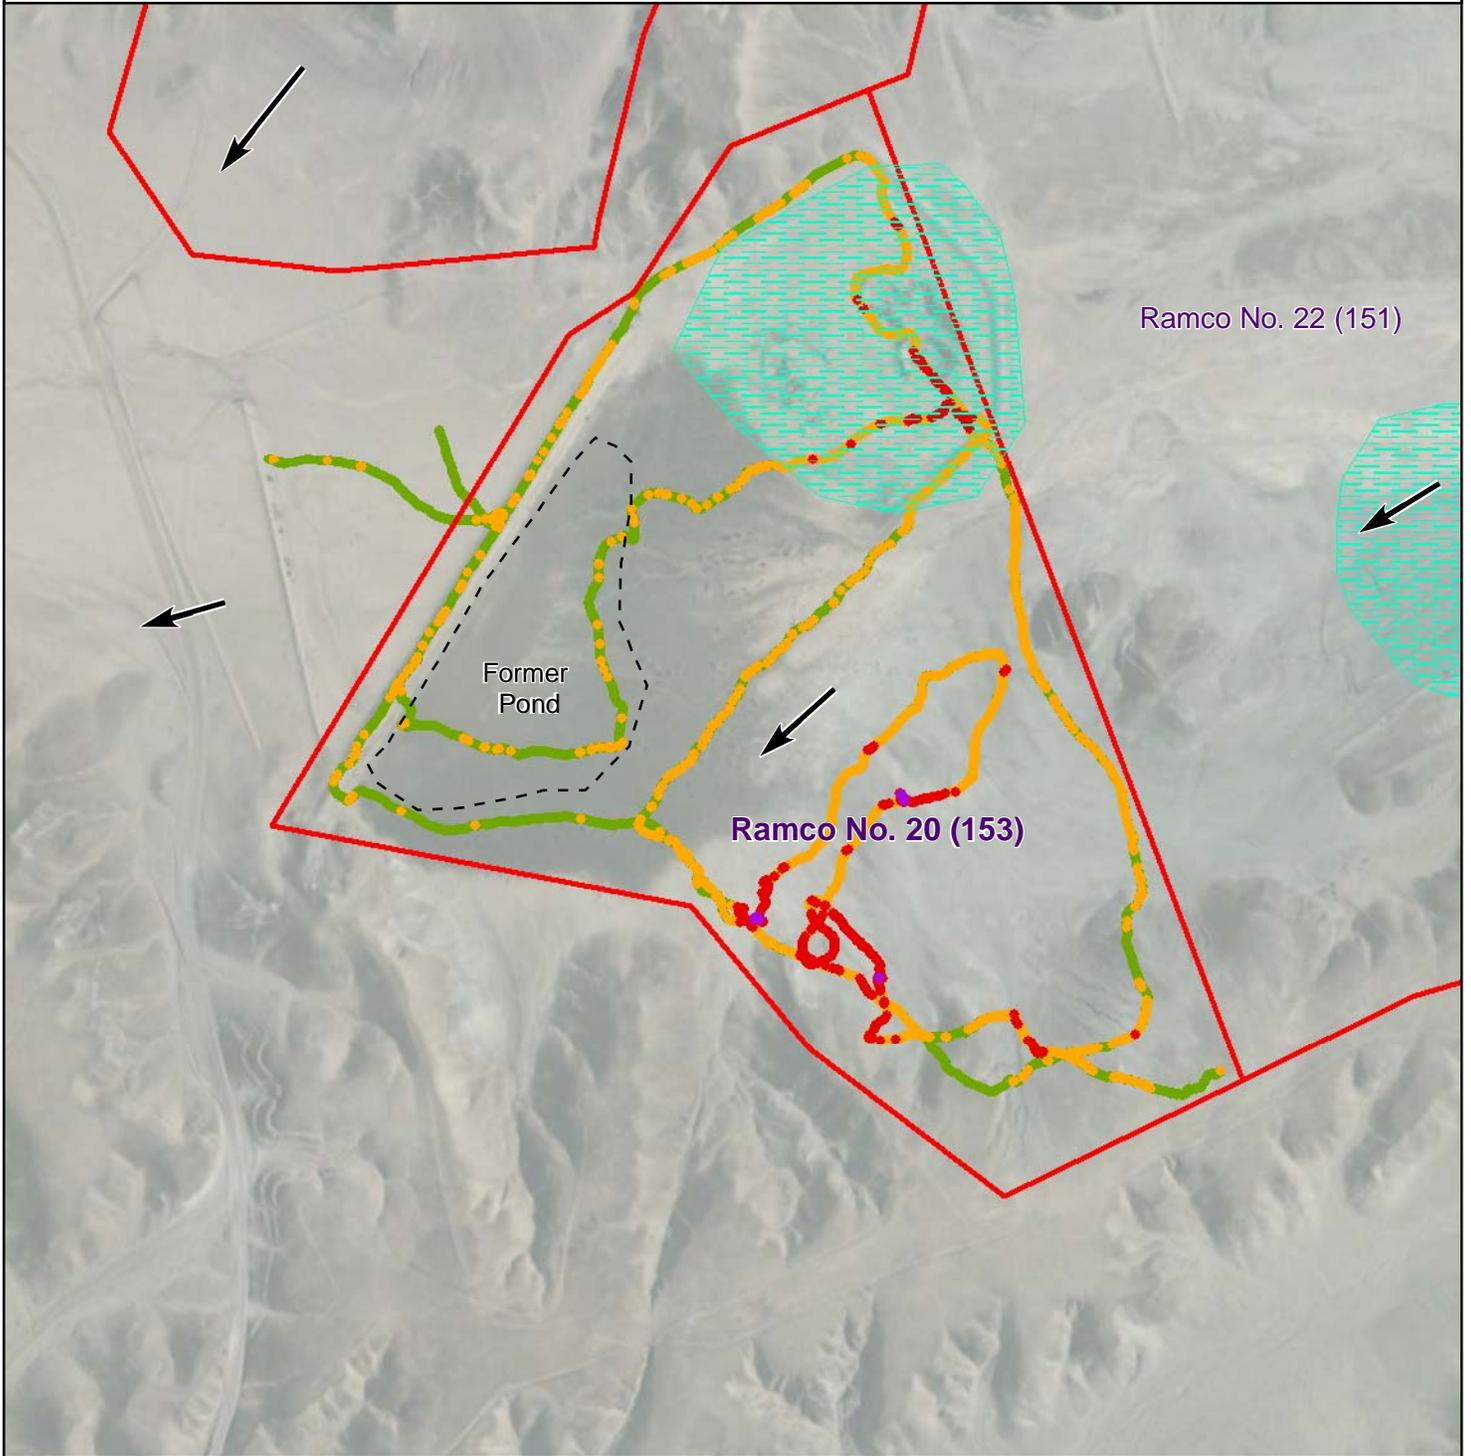

**Legend**

**Gamma Radiation Measurements**

- 0 - 10,000
- 10,000 - 15,000
- 15,000 - 20,000
- 20,000 - 50,000
- 50,000 - 100,000
- > 100,000

- ➔ General Slope Direction
- ▨ Observed Reclamation Area
- ▭ Mine Site Boundary



**Gamma survey conducted 11/2010  
 Measured as counts per minute (cpm)**

**Average background 12,312 cpm**

